

Date: Thursday, 8/30/2007 3:45:55 PM
 User: Kim Johnston

Process Sheet

40

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : SKIDTUBE ASSEMBLY
Job Number : 34340	
Estimate Number : 10022	
P.O. Number : N/A	Part Number : D205634011
This Issue : 8/30/2007 S.O. No. : N/A	Drawing Number : N/A
Prsht Rev. : NC	Project Number : N/A
First Issue : N/A Type : LANDING GEAR	Drawing Revision : N/A
Previous Run : 34339	Material : N/A
Written By : <u>[Signature]</u>	Due Date : 9/30/2007 Qty: 1 Um: Each
Checked & Approved By : <u>[Signature]</u>	
Comment : Est Rev: P 02.08.28 Removed QC5 from Step 5 KJ	

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



KS 07 09 12 (1)

Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D205-634-011 CHG005

En 7/10/11

2.0 34340A SKID TUBE ASSEMBLY



Comment: Sub-Component SKID TUBE ASSEMBLY
 D205-634-041 B 34340 A

CP

3.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1
 Pick Packing Kit

4.0 K10003 D205-634-011 Saddle Kit



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
 Pick:

Qty	Part Number	Description	Batch
1	K10003	Saddle Kit	B34355

CP 07/10/11 @

5.0 QC4 INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

En 11/10/11

6.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-011

Location: REV-J

CP 07/10/11 @

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: D Date: 07/10/12
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 8/30/2007 3:45:55 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKIDTUBE ASSEMBLY

Job Number: 34340

Part Number: D205634011

Job Number:



Seq. #:

Machine Or Operation:

Description :

7.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Handwritten signature/initials

Job Completion



Handwritten signature/initials

Handwritten text in a box: 34340A

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

40

Date: Thursday, 8/30/2007 3:46:27 PM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : SKID TUBE ASSEMBLY
 Job Number : 34340A
 Estimate Number : 10023
 P.O. Number : *N/A*
 This Issue : 8/30/2007 S.O. No. : *N/A*
 Prsht Rev. : NC
 First Issue : *N/A* Type : LANDING GEAR
 Previous Run : 34339A
 Part Number : D205634041
 Drawing Number : D2580 REV D
 Project Number : N/A
 Drawing Revision : D
 Material : *N/A*
 Due Date : 9/30/2007 Qty: 1 Um: Each
 Written By : *[Signature]*
 Checked & Approved By : *[Signature]*
 Comment : Est Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ
 Est Rev. O 06.02.28 Added paperwork EC
 Est Rev:P 07-07-09 SS Wearplates & Gaskets JLM

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description:

1.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy D205-634 bluefile & type labels per PPP D205-634 CHG002

2.0

D25001190

Ext'n -1" Beam Tube 4"



Comment: Qty.: 1.0400 Each(s)/Unit Total: 1.0400 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2500-1-190

Skid Tube Extrusion

*29602**RT**07-09-08*

3.0

D2596

205 Web



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2596

205 Web

*33836**RT**07-09-10*

4.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2580 if necessary Debur ends

3-Acid etch and Alodine tube per QSI 005 4.1

RT 07-09-09

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 8/30/2007 3:46:27 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 34340A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description:

4-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

5-Open holes to 0.500" as per Dwg D2580without cutting fluid

6-Countersink holes as per Dwg D2580without cutting fluid

7-Deburr and blow out all chips from inside of tube

8-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291

Sikaflex expire date: 08-07-01

Start Time: 11:30

Date: 07-09-10

Fin Time: 4:00

Date: 7-9-10

21 07-09-09

25 07-09-10

27 07-09-10

5.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

7-9-12

6.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends after cutting. Remove alodine from around holes

AWM 07/09/17 7-9-17

7.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

all pins so thick and align

07/09/17

8.0

D25763

Step (Machining Detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2576-3

Step

B-33464 BE 07-09-29

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 8/30/2007 3:46:27 PM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 34340A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description:

9.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total: 20.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
20	D2579	Spacers	B33347

BE 07-09-29

10.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Prepare tube for welding D2576-3 StepRemove alodine as required.

BE 07-09-29

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

M105058

BE 07-09-29

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

M105058

BE 07-09-29

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

SL 7-10-1

5-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Debur

DP 7-10-2

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Debur holes

7-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

SL-7-10-1 DP 7-10-2

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

DP 7-10-2

11.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

PD 07-10-03

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

SL 07/10/03

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 8/30/2007 3:46:27 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 34340A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



(IX)

Comment: HAND FINISHING RESOURCE #1
Pressure wash as per QSI 005

M-1

07/10/03

14.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M

07-10-04

(1)

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FL

07/10/05

(1)

16.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch:

B29608

FL

17.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch:

m100188

FL

18.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch:

m104885

FL

19.0

ALS71032130

Insert



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

Insert

Batch:

~~m105709~~ m105855

FL 07/10/05 (1)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 8/30/2007 3:46:27 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 34340A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

AN3C4A

BOLT



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

BOLT

Batch: m/05810

Fel

21.0

AN960C10L

washer



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

washer

m/104537

Fel

22.0

D356613

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B32660

Fel

23.0

D35665

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B33806

Fel

24.0

D35661

GASKET



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

GASKET

Batch: B34200

Fel

25.0

D356413

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B33761

Fel

26.0

D356411

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: ~~B33778~~ B34352

Fel 07/10/05 ①

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 8/30/2007 3:46:27 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 34340A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

27.0

D35649

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 633457

FL

28.0

D35645

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 632738

FL

29.0

D25943

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: 627168

FL

30.0

D25941

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: 631109

FL

31.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R Sikaflex-291

Sikaflex expire date: 08-01

M105469

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291

Sikaflex expire date: 08-01

M105469

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch:

M105694

07-10-10

FL
07/10/10

①

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: D Date: 07/10/12
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 8/30/2007 3:46:27 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 34340A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

32.0

QC5

INSPECT WORK TO CURRENT STEP



EO 08/10/10



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

33.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location: _____

PPP Rev: _____

PP 34340 08/10/10

34.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/10/10 ①

Job Completion



U 08/10/10 2

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

RELEASED
07-06-28 *[Signature]*

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

GENERAL NOTES:


- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
SEE NOTES ON
PAGE 2 FOR D2580-041 AND
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 34340A


Copyright © 1996 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.


DETAIL A
SCALE 5:24

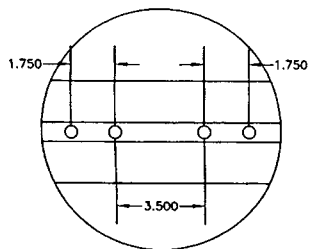


DETAIL B
SCALE 5:24

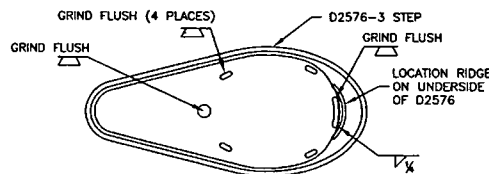


D2580-1 DRILLING DETAIL

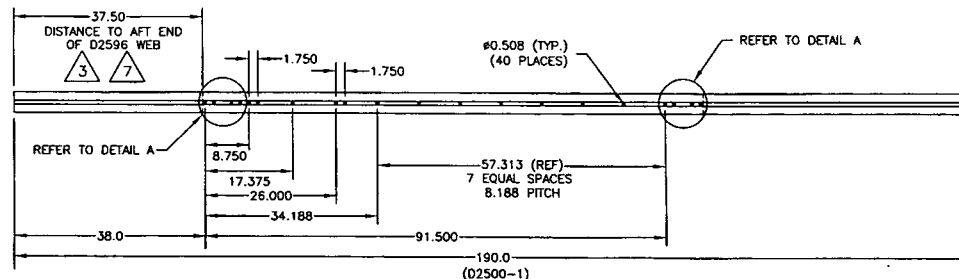


D2580-1 BENDING AND CUTTING DETAIL

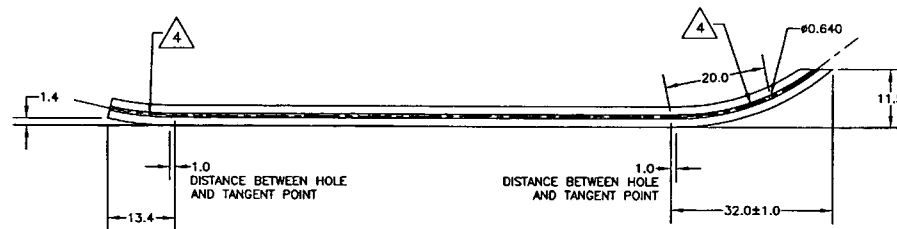


D2580-041 ASSEMBLY DETAIL

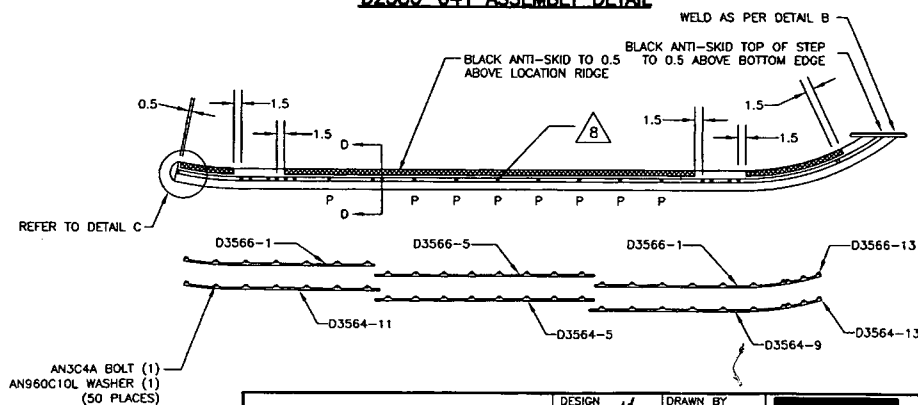

SECTION D-D
SCALE 5:24

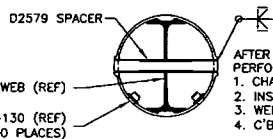

AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP

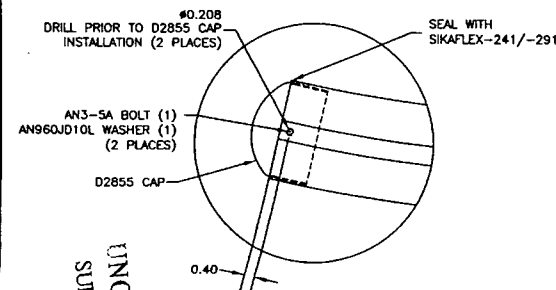

NO. 35240 A
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

D2580-041 NOTES


- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

COPYRIGHT © 1996 BY DART AEROSPACE LTD.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN	DRAWN BY	DART	DART AEROSPACE LTD.
CHECKED	APPROVED	DRAWING NO.	REV. D
DATE		D2580	SHEET 2 OF 3
07.02.27		TITLE	SCALE
		205 SKIDTUBE ASSEMBLY	1:24

DETAIL E
SCALE 5:24

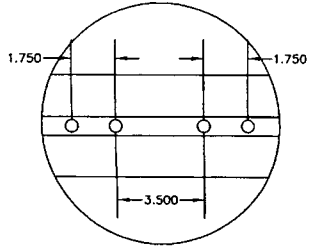


DETAIL F
SCALE 5:24

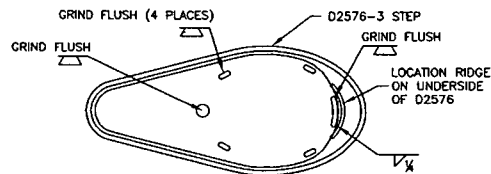


RELEASED
07.02.27

DETAIL G
SCALE 5:24

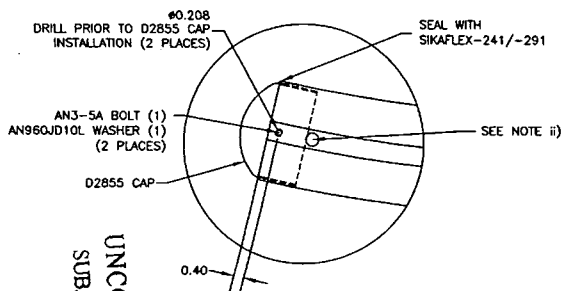


SECTION H-H
SCALE 5:24

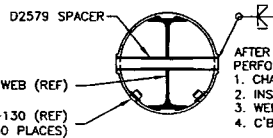


- AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
 2. INSERT D2579 SPACER (20 PLACES)
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP


D2580-1 DRILLING DETAIL

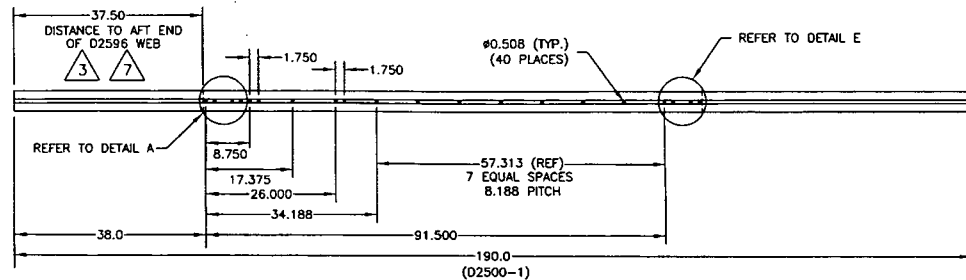

D2580-5 BENDING AND CUTTING DETAIL
(MAKE FROM D2580-1 DRILLING DETAIL)

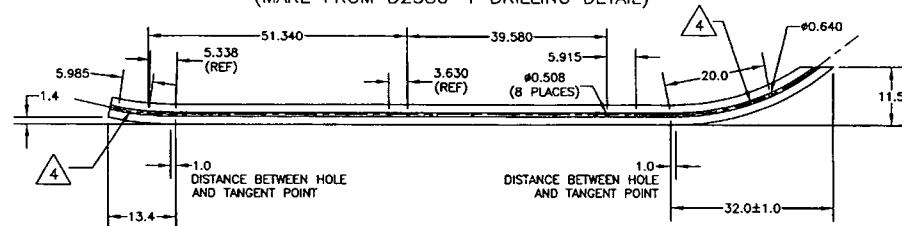

D2580-045 ASSEMBLY DETAIL

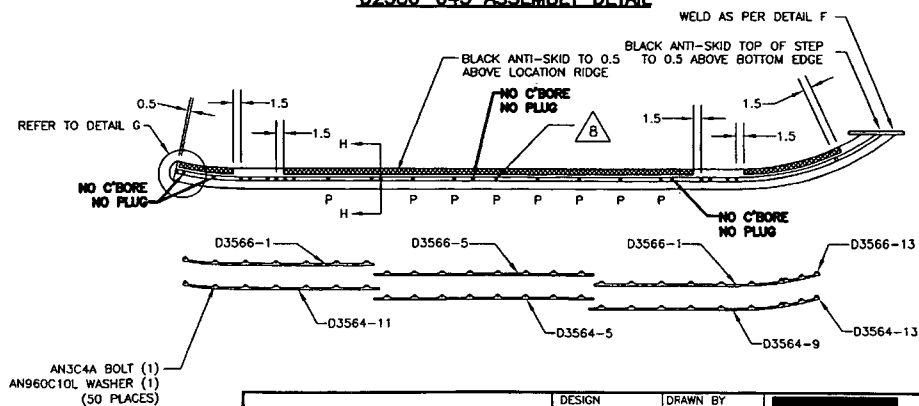

D2580-045 NOTES

- FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

COPYRIGHT © 1996 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN RH	DRAWN BY RH	DART DART AEROSPACE LTD. WARRICKSBURY, OXFORD, CANADA	REV. D
CHECKED H	APPROVED H	DRAWING NO. D2580	SHEET 3 OF 3
DATE 07.02.27	TITLE 205 SKIDTUBE ASSEMBLY	SCALE 1:24	

NO. 129

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barclay Elliott
Joint Welding Procedure L.C.
Part number and Job number 02205 B34 CWI / B34337A

TEST WELDS REQUIRED

BASE METAL Aluminum WELDING PROCESS L.C.
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07-10-03

Qualifier P. D. Del